

Work Order ID 129876

February 23-15 10:28:34 AM

129876

Page 1

Item ID: D119-796-141TRN

Accept

N900040100

Setup Start *NS1*

Revision ID:

Stop *NS2*

Item Name: Crosstube Turning Detail

Start Date: 3/02/15 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/02/15 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: MLJDate: 15-02-25

Tooling:

Date:

Run Start *NR1*

QC:

Date:

SPC (Y/N):

Date:

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D119-796-141

F

100

0.00

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Fill tube with sand & install plugs on both ends as per Folio FB316

2-Turn first side as per Folio FB316

3-Blend transition lines only, **do not sand whole tube**:

FOLIO REV: AADWG REV: 7

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Memo

0.00

Quality Control

15/03/12
mmml
15/03/12

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other		

Work Order ID 129876***129876***

Page 2

February-23-15 10:28:34 AM

Item ID: D119-796-141TRN

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Crosstube Turning Detail

Start Date: 3/02/15 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/02/15 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

NR1

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

0.00

120

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

0.00

Mori Seiki CNC Lathe Large

1-Turn second side as per Folio FB316

2-Blend transition lines only, **do not sand whole tube**:

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

FOLIO REV: AADWG REV: AA

3-Remove sand and plugs

4- scribe batch # and part # as per dwg

1 ϕ mm
15/03/16

130

QC1- Inspect dimensions to dimension sheet

0.00

130

QC

Memo

0.00

Quality Control

1 ϕ mm
15/03/16

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other

Work Order ID 129876

129876

Page 3

February-23-15 10:28:34 AM

Item ID: D119-796-141TRN Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Crosstube Turning Detail
 Start Date: 3/02/15 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 3/02/15 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC8- Inspect parts - second check	0.00				1	0	DAS 47 9-89	
140									
QC	Memo	0.00							
Quality Control								15-03-20	
145		0.00							
145									
Crosstubes	Memo	0.00							
Crosstubes	GRIND ONLY TRANSITION LINES SMOOTH LONGITUDE WAY.								
150		0.00							
150									
HandFXtube	Memo	0.00							
Hand Finishing Crosstubes	1- PRESSURE WASH X-TUBE INSIDE AND OUT								
	2- ACID ETCH X-TUBE INSIDE AND OUT. USE RED SCOTCH BRITE								

BC 15-04-10
 JTW 15-04-13
 BC

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 129876

129876

Page 4

February-23-15 10:28:34 AM

Item ID: D119-796-141TRN Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Crosstube Turning Detail
 Start Date: 3/02/15 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 3/02/15 Req'd Qty: 1.00 *1* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160 *160* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.00				1			DAS 38 9-89 15-04-14
170 *170* Packaging Packaging	Packaging Memo Identify and stock in kanban rack Location: <u>LG</u>	0.00 0.00							POSITIVE RECALL EFFECTIVE <u>5-03-19</u> AUTH <u>U</u> RELEASED <u>GP</u> DATE <u>5/3/24</u> Tolerance FAI JTW 15-04-14
180 *180* QC Quality Control	QC21- Final Inspection - Work Order Release Memo	0.00 0.00							MLD 15-04-15 ME 15-4-15

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐
--	--	---

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

February-23-15 10:28:33 AM

Page 1

Work Order ID: 129876

129876

Parent Item: D119-796-141TRN

D119-796-141TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 3/02/15

Required Date: 3/02/15

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP REV A RQ 14/06/06 VERIFIED BY DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6005-128		Manufactured	No			100	Each	58.0000	1	1			

D6005-128

Crosstube Material

Location

Loc Qty

Loc Code

LG003

58

107872

29

75631

6

75638

1

75642

22

_____ *mm L 15/03/05*

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other


DART AEROSPACE LTD		Work Order: 129876
Description: Crosstube Assembly		Part Number:
Inspection Dwg: D119776/41 Rev: F		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A						
	A.010	± 0.010	.010	✓	RG	
	6.00	± 0.010	6.00	✓	vern	CNC-08
	2.516	± 0.005	2.518	✓	↓	
	2.516	± 0.005	2.518	✓		
	2.333	± 0.005	2.336	✓		
	2.333	± 0.005	2.337	✓		
	2.408	± 0.005	2.412	✓		
	2.502	± 0.005	2.502	✓		
	2.596	± 0.005	2.600	✓		
	2.596	± 0.005	2.599	✓		
SIDE B						
	R.010	± 0.010	.010	✓	RG	
	6.00	± 0.010	6.00	✓	vern	CNC-08
	2.516	± 0.005	2.517	✓	↓	
	2.516	± 0.005	2.517	✓		
	2.333	± 0.005	2.336	✓		
	2.333	± 0.005	2.337	✓		
	2.408	± 0.005	2.412	✓		
	2.502	± 0.005	2.507	✓		
	2.596	± 0.005	2.599	✓		
	2.596	± 0.005	2.598	✓		
	102.26	± 0.020	102.26	✓	tape	LG-11

DART AEROSPACE LTD		Work Order: 129876
Description: Crosstube Assembly		Part Number:
Inspection Dwg:	Rev:	Page 2 of 2

WALL THICKNESS MEASUREMENT

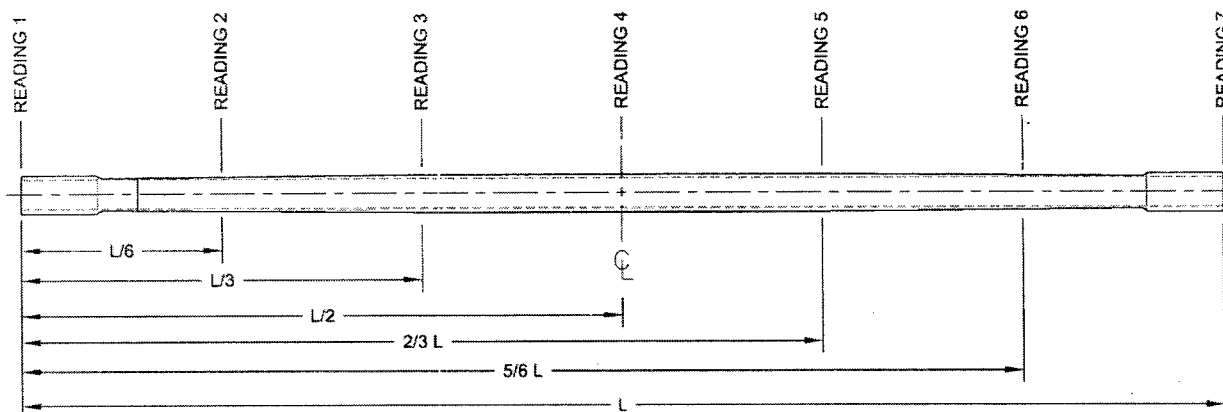

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE	Avg	L
	w1	w2	w3	w4				
READING 1 L= 0"	.285	.267	<.243>	.271	.042	0.030	0.258	0.015
READING 2 L= 17	.208	<.168>	.169	.202	.040	0.030	0.179	0.011
READING 3 L= 34	.306	.269	<.248>	.277	<.058>	0.063	0.265	0.020
READING 4 L= 51	.325	.300	.283	.302	.042			
READING 5 L= 68	.293	.274	.264	.279	.029			
READING 6 L= 85	.212	.184	<.165>	.193	.047	0.030	0.179	0.014
READING 7 L= 102	.260	.260	<.249>	.270	.031	0.030	0.258	0.009

Calibration Result

Actual Block Thickness: .100 - .750

DAS 47 Sitescan 250 Measured Thickness: .100 - .750


Measured by: <u>MAN L</u>
Date: <u>15/03/16</u>

Audited by: <u>DAS 47</u>
Date: <u>15-03-20</u>

Preliminary Approval: <u>DAS 12</u>
Date: <u>15/3/24</u>

Rev	Date	Change	Revised by	Approved
B	10.04.14	Added preliminary approval	KJ	
C	12.06.01	Wall thickness form added	KJ	

ITEM	QTY	P/N	DESCRIPTION
	X	D119-796-141	XTUBE ASSY (AW119 MKII FWD)
1	1	D119-796-141BND	CROSSTUBE, FWD
2	4	D2873-043	RADIUS BLOCK
3	4	D5123-3	CLAMP CUSHION
4	2	D5124-1	FWD SUPPORT
5	2	D5152-041	FWD POST MOUNT ASSY
6	16	CR3212-4-07	RIVET, BLIND CSK
7	4	MS21920-24	CLAMP

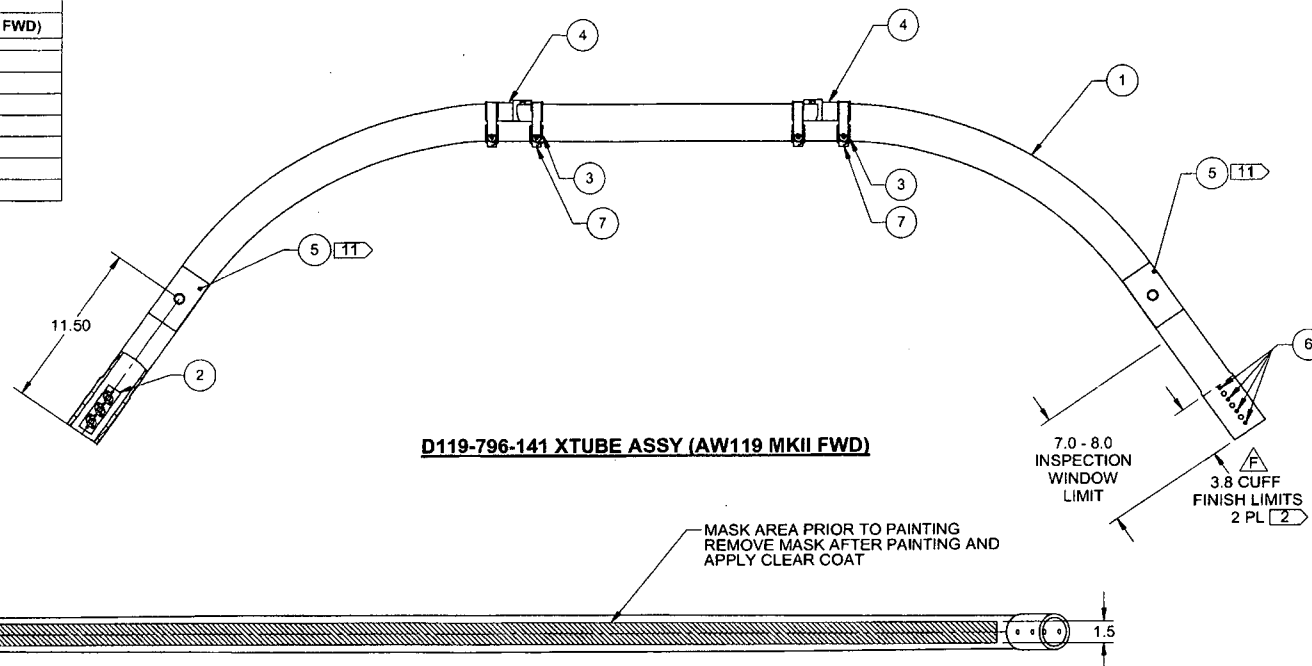

D119-796-141 XTUBE ASSY (AW119 MKII FWD)

RELEASED

2015 FEB 09


ECN 15-526

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: MASK UNDERSIDE OF CROSSTUBE AS SHOWN (B3-1, HATCHED AREA), PAINT OUTSIDE PER DART QSI 005 4.2 REMOVE MASKING AND APPLY MATTE CLEAR COAT DO NOT APPLY FINISH (PAINT OR CLEAR COAT) TO CUFFS IN LOCATION SHOWN, MASK PRIOR TO FINISHING
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY USING PART NUMBER "D119-796-141" AND BATCH NUMBER ON INSIDE OF CUFF PER QSI 044 6.4
- 7) WEIGHT: 18.43 lbs
- 8) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM DEFECTS SUCH AS SCRATCHES, NICKS OR DENTS. DEFECTS UP TO 0.005 MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 9) AFTER FINISHING, ABRASE MATING SURFACES OF D5124-1 FWD SUPPORTS AND CROSSTUBE WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH'N'WIPE DEGREASER. APPLY A 0.100 MIN THK LAYER OF PROSEAL 890 ON THE INSIDE CONCAVE SURFACE OF THE D5124-1 FWD SUPPORTS AND INSTALL AT AN 8.4" OFFSET FROM THE CROSSTUBE BENDING PLANE. INSTALL THE MS21920-24 CLAMPS AND D5123-3 CLAMP CUSHIONS WHILE WET.
- 10) TORQUE MS21920 CLAMPS 80 - 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY, THE NUT IS FACING AFT AND HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.
- 11) PRIOR TO FINISHING, ABRASE MATING SURFACES OF CROSSTUBE AND D5152-041 WITH SCOTCH BRITE 7447 RED AND REMOVE RESIDUE WITH DUPONT 4105S WASH'N'WIPE DEGREASER. INSTALL D5152-041 WITH LAYER OF PROSEAL 890 ON INSIDE CONCAVE SURFACE, 0.100 MIN THK. LOCATE D5152-041 USING TOOL DT10089.


F	REMOVED PRIME/ PAINT ON CUFFS, 2 516 WAS 2 500 (C8-6)	AP	15.02.03
E	D5152-041 FWD STEP POST ASSY WAS D5150-1 STEP POST, SCOTCH BRITE 7447 RED WAS 180 GRIT SANDPAPER, ANGLE (B7-2) DIMENSIONED FROM NEW DATUM	DB	15.01.15
D	ADD D5150-1 STEP POST (2X), MOVED INSPECTION WINDOW DETAIL TO SHEET 1, MODIFIED NOTES ON SHT 1 & 3	DB	14.11.25
C	CR3212-4-07 RIVETS WERE CR3212-4-09, 7.5 DEG CUFF ANGLE OFFSET REMOVED (SHT 3), CUFF DIAMETER ON D119-796-141 TRN REDUCED TO 2.500, ADDED INSPECTION WINDOW (B7-3), ADDED SHT 4	AP	14.10.23
B	ADDED D2873-043 RADIUS BLOCK, CR3212-4-09 RIVETS, ADDED SKIDTUBE REFERENCE FOR LOCATING CUFF HOLES, RE-ORGANIZED NOTES AND REMOVED REDUNDANT INFORMATION	AP	14.09.02
A	NEW ISSUE	AP	14.08.09
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. F
MFG. APPR.	JLM	D119-796-141	SHEET 1 OF 6
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE	15.02.03	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR FOR REPRODUCTION IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

APPROVED

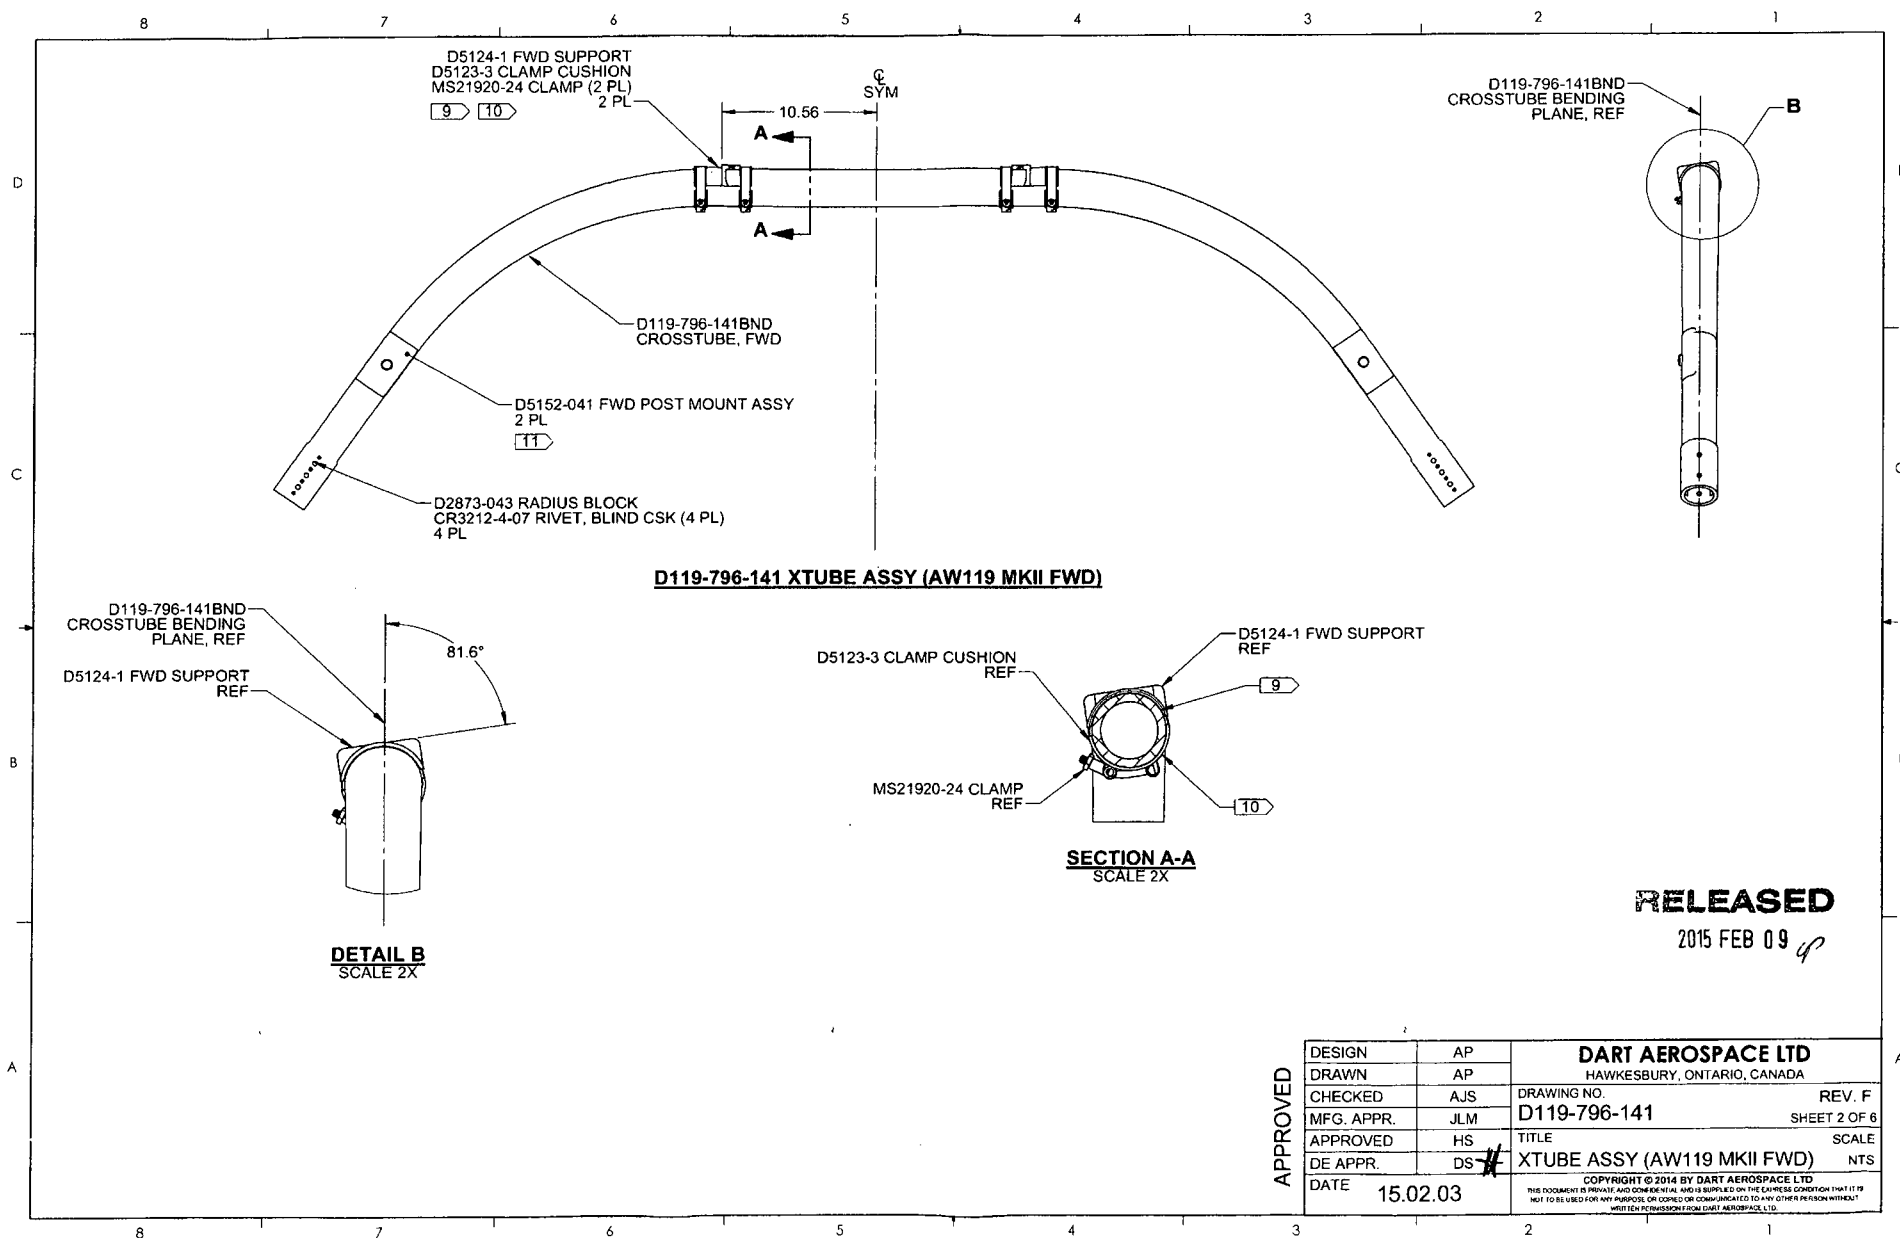

APPROVED

DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. F
MFG. APPR.	JLM	D119-796-141	SHEET 2 OF 6
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE	15.02.03	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE, OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

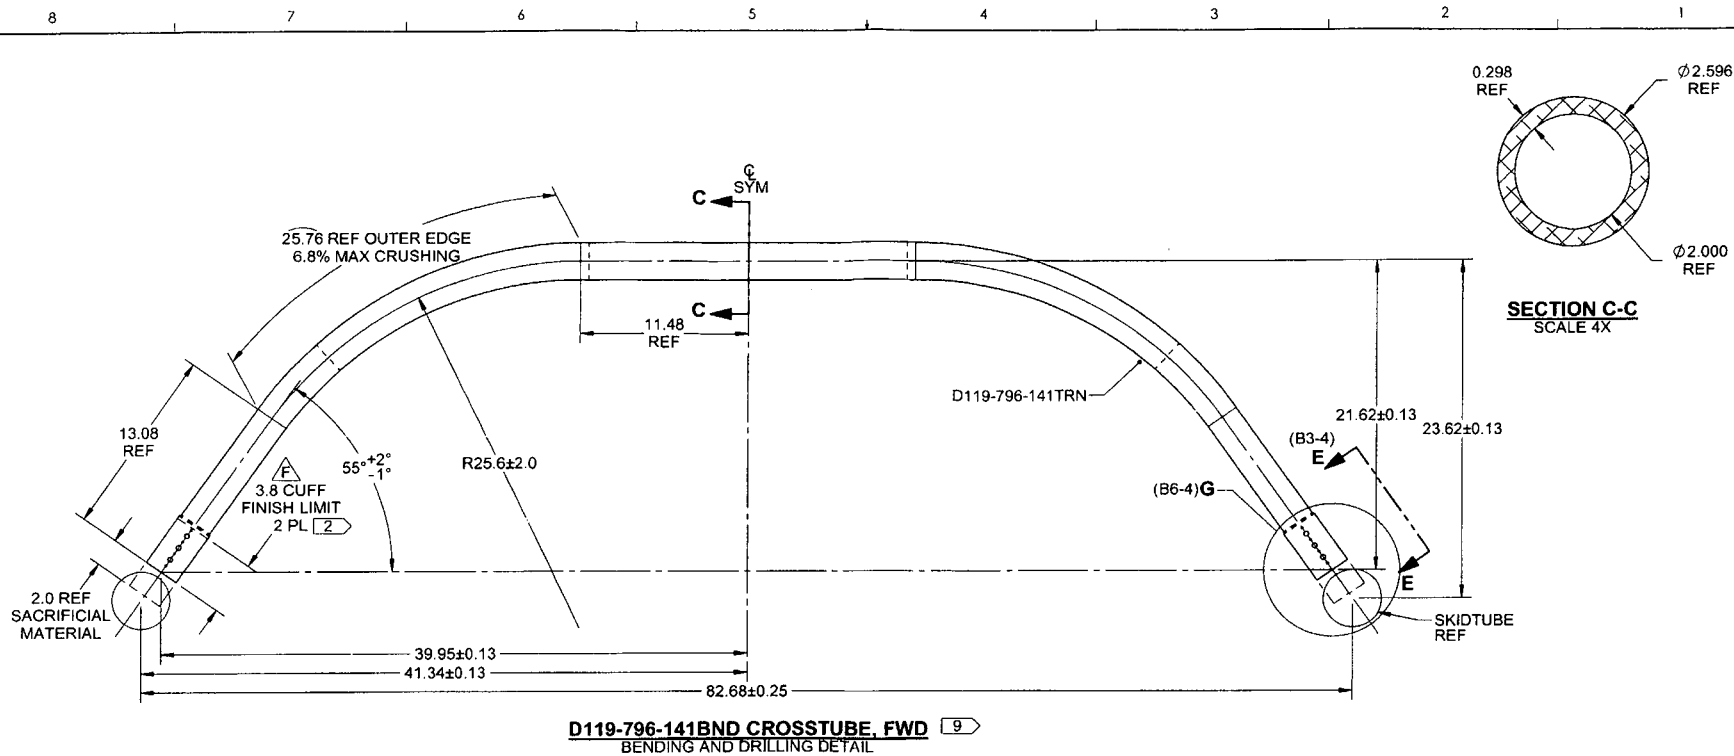

NOTES:


- 1) MATERIAL: MADE FROM D119-796-141TRN
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
DO NOT APPLY PRIMER TO CUFFS IN LOCATION SHOWN, MASK PRIOR TO FINISHING
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 16.70 lbs
- 8) PART IS SYMMETRICAL ABOUT CENTERLINE
- 9) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6.8% BASED ON OD.
- 10) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038
- 11) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM DEFECTS SUCH AS SCRATCHES, NICKS OR DENTS. DEFECTS UP TO 0.005 MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

RELEASED


2015 FEB 09

APPROVED

DESIGN	AP	DART AEROSPACE LTD	
DRAWN	AP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AJS	DRAWING NO.	REV. F
MFG. APPR.	JLM	D119-796-141	SHEET 3 OF 6
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE	15.02.03	COPYRIGHT © 2014 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL. AND IS SUPPLIED ON THE UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

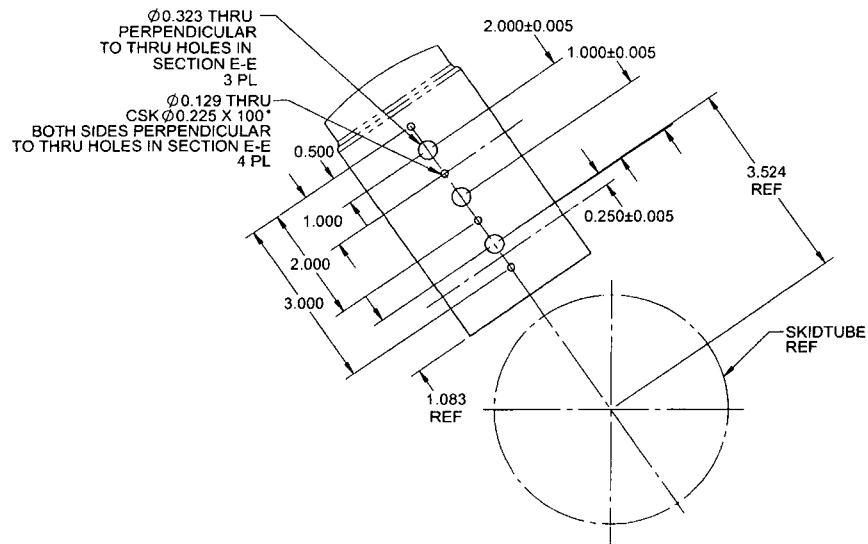

DETAIL G (C2-3)
SCALE 4X

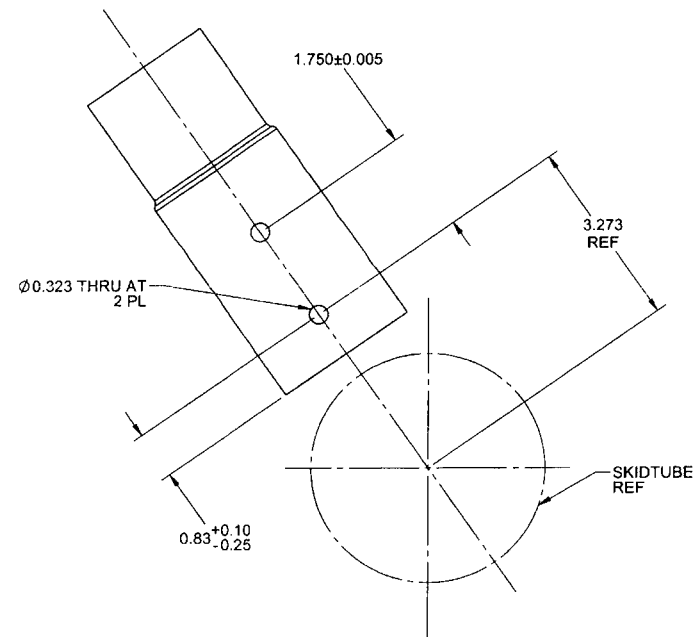



SECTION E-E (C2-3)
SCALE 2X

RELEASED

2015 FEB 09

APPROVED

DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. F
MFG. APPR.	JLM	D119-796-141	SHEET 4 OF 6
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE	15.02.03	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

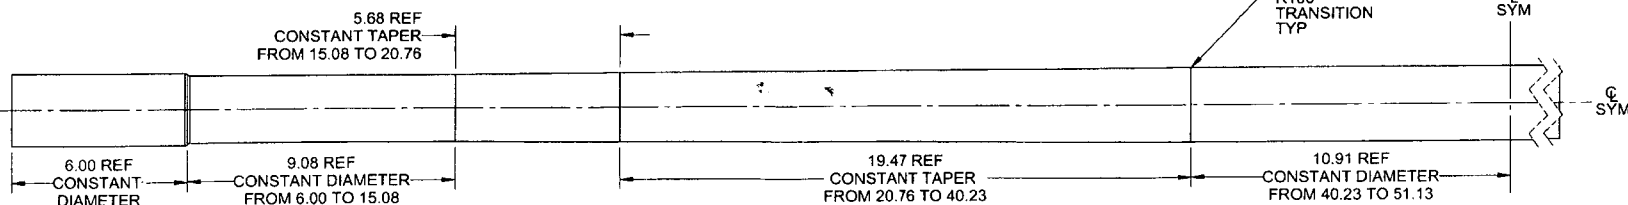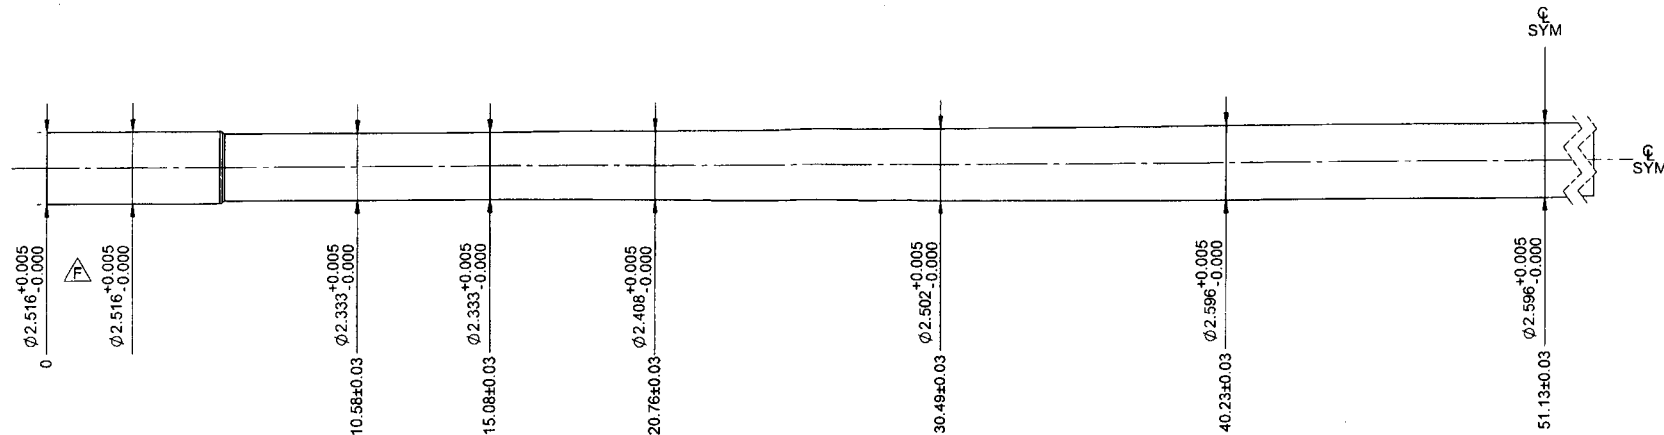

D119-796-141TRN CROSSTUBE, FWD

RELEASED


2015 FEB 09

NOTES:

- 1) MATERIAL: MANUFACTURE FROM D6005-103
FINISHED LENGTH = 102.26 ± 0.020 (BEFORE BENDING/TRIMMING)
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 16.70 lbs
- 8) PART IS SYMMETRICAL ABOUT CENTERLINE

APPROVED

DESIGN	AP	DART AEROSPACE LTD	
DRAWN	AP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AJS	DRAWING NO.	REV. F
MFG. APPR.	JLM	D119-796-141	SHEET 5 OF 6
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE	15.02.03	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

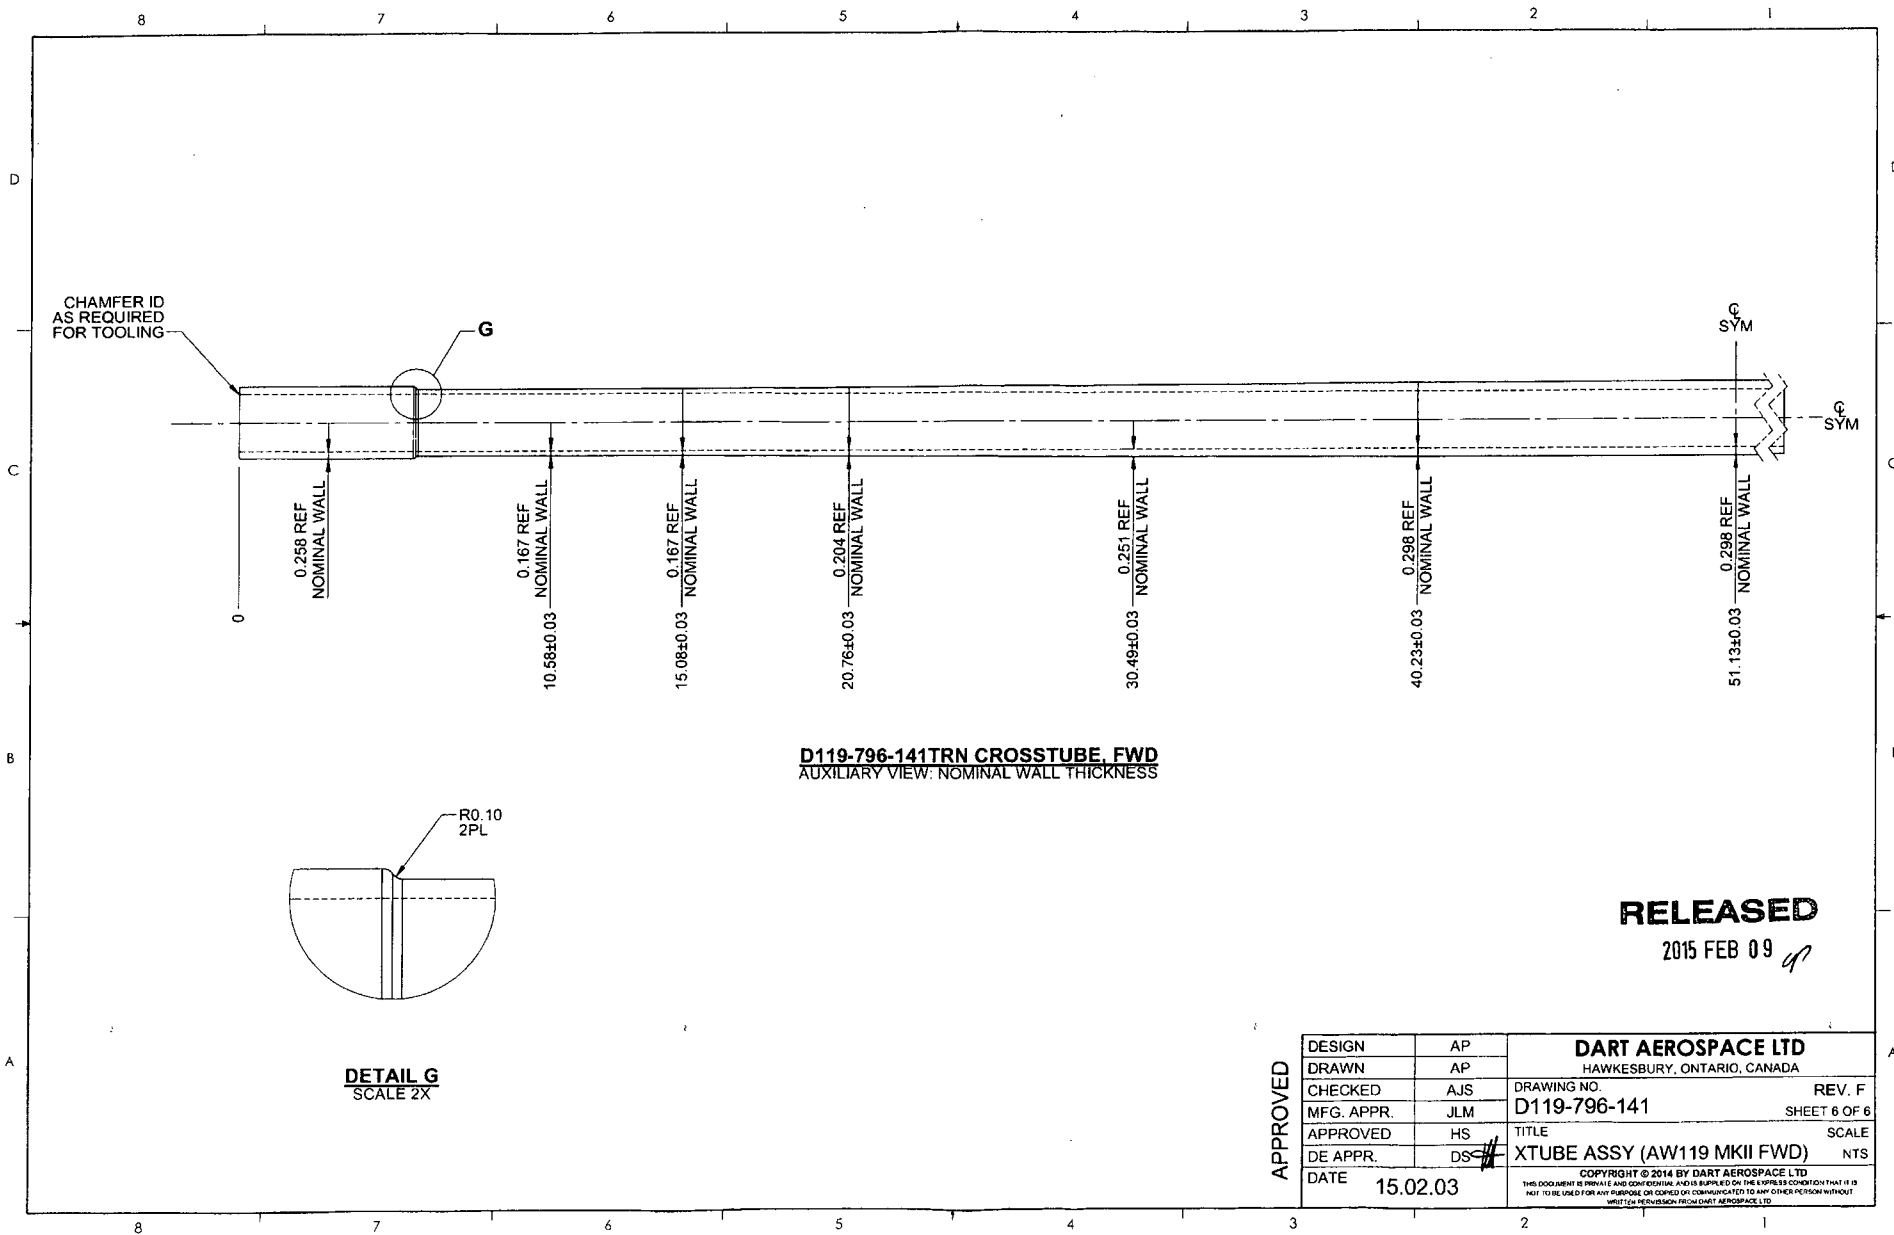

APPROVED	DESIGN	AP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
	DRAWN	AP		
	CHECKED	AJS	DRAWING NO.	REV. F
	MFG. APPR.	JLM	D119-796-141	SHEET 6 OF 6
	APPROVED	HS	TITLE	SCALE
	DE APPR.	DS	XTUBE ASSY (AW119 MKII FWD)	NTS
DATE		15.02.03	COPYRIGHT © 2014 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE

DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Work Order Update ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Crosstube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data	15.04.14	1	1	WALL THICKNESS MEASUREMENTS ARE OUT OF TOLERANCE (READING 1, 2, 6, 7)	A.R. 15.04.14	SEE ATTACHED INSPECTION SHIT. THE GREATEST DELTA FROM NOMINAL WALL THICKNESS IS 0.015. DEVIATION IS ACCEPTABLE PROVIDED "W3" IS IN UP/DOWN DIRECTION IN BENDER	A.R. 15.04.14				
Equip/Tooling											
Operator											
Material											
Setup											
Other											
Process											
Supplier											
Training											
Unapproved											

FAULT CATEGORY			
Landing Gear ☐ Bending ☐ Centre Not Concentric to O/S ☐ Cracks ☐ Crushed/Crimped. ☐ Cuffs ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Ripples in Bend ☐ Torque Waves in Extrusion ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damaged ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drill Holes ☐ Drawing ☐ Finish ☐ Folio	☐ Grain ☐ Hardware ☐ Inspection Incomplete ☐ Instructions Incomplete/Unclear ☐ Maintenance ☐ Mislabeled ☐ Misread ☐ Offset ☐ Out of Calibration ☐ Out of Sequence ☐ Outside Dimensions	☐ Ovalized ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other